
Service Bulletin

DIVISION: Automotive
NUMBER: SC-01 OCT 92
PAGE : 1 of 3

SUBJECT : Service Action: L3
Exhaust Pipe
1992-1993 4-Door Sidekick, Federal Specification (E3)
1992 4-Door Sidekick, California Specification (E33)

Suzuki has determined that the exhaust pipe, located between the exhaust manifold and the center pipe, may develop an internal restriction causing abnormal exhaust noise, reduced maximum power, and reduced fuel economy.

To preclude the possibility of the conditions stated above, ASMC is providing installation of a revised exhaust pipe on affected vehicles at no charge.

Affected Vehicles

- 1992: All 4-Door Sidekick, Two (2) and Four (4) Wheel Drive, Federal (E3) and California (E33) Specification.
- 1993: 4-Door Sidekick, Two (2) Wheel Drive Federal (E3) Specification with Vehicle Identification Numbers up to and including JS3TE01V1P4100394.
4-Door Sidekick, Four (4) Wheel Drive Federal (E3) Specification with Vehicle Identification Numbers up to and including JS3TD02V8P4104007.

NOTE: 1993 4-Door Sidekick Two (2) and Four (4) Wheel Drive, California Specification (E33), are not involved in this Service Action.

Owner Notification

Suzuki owners will be notified of this Service Action by American Suzuki Motor Corporation. Please see attached owner notification letter.

Dealer Service Action Responsibility

Dealers are to perform this Service Action on all affected vehicles upon customer request.

All affected in-dealer-stock inventory vehicles subject to this Service Action must receive this modification before you sell or lease the vehicle.

If an affected vehicle is currently in your Service Department or is brought in for other service, use this opportunity to perform this Service Action. Be certain to inform the customer of this Service Action.

This Service Action may have been previously performed. To avoid duplicate repairs, all affected vehicles must be inspected prior to installation. Refer to attached Technical Service Bulletin #TS 4-15 10192 for component identification and installation procedures.

Parts Information

Parts should be ordered to cover all affected vehicles in your inventory and for the customers vehicles that require the Service Action performed.

We recommend that care be taken in ordering these Service Action parts as normal Parts Return Policy applies. Refer to the ASMC Parts Department Operations Manual.

<u>Replacement Part Number</u>	<u>Part Name</u>	<u>Quantity Per Vehicle</u>
14190-57B12 ---	PIPE, EXHAUST NO. 1	1

Claim Procedure

Service Action variations:

- JB - Install Service Action part using existing gaskets. Labor Time 0.8 hrs.
New in-dealer-stock and low mileage vehicles DO NOT require the exhaust manifold gasket.
- JC - Install Service Action Part replacing gasket at exhaust manifold only. Labor Time 0.8 hrs.
- JK - Unspecified Variation (See Special Procedures for SCAT Claim Completion).

NOTE: Labor times include corrosion and rust conditions.